

TS&IS/0007																
MONTHLY RETURNS ON ACCIDENT INVESTIGATED FOR THE MONTH OF OCTOBER, 2019																
AREA INSPECTORATE FIELD OFFICE: EKO ZONAL OFFICE																
S/N	DATE OF INVESTIGATION	ACCIDENT DESCRIPTION	ACCIDENT TYPE	LOCATION	DISCO	REPORTED BY	DATE REPORTED/OCCURRED	FATALITIES	INJURIES	HISTORICAL INCIDENT (If Any)	INVESTIGATED BY	POSSIBLE ROOT CAUSES	ACTIONS TAKEN	DETAILS OF EYE WITNESSES (CONTACTS)	FOLLOWUP ACTIONS (DATE) & OUTCOME	RECOMMENDATIONS MADE TO ELIMINATE SURFACE & ROOT CAUSES
1	Oct 30TH, 2019	On the 18th of Oct, 2019, a mobile crane banksman (motor boy) received electric shock when the jib (arm) of the crane made accidental contact with the yellow phase of an already energized 11kv Overhead feeder. He was thrown off due to the impact of the shock received. Unfortunately, in trying to wrench the jib from the energized line, the driver reversed the mobile crane and inadvertently crushed the body of the banksman. It is unclear whether the deceased died as a result of the electric shock received, or due to cranial/fractural damage sustained when he was crushed by the tyres of the mobile crane	Electrocution.	Happy Homes Avenue, Apapa Lagos.	EKO	EKO DISCO	OCT 21ST 2019/ 18TH OCT, 2019	ONE	NIL	NIL	1.ENGR. ITODO, E.E ; 2. ENGR. CHIAGOZIE ONYIA; 3. FESTUS OGHENEGWEKE	1. CONTACT WITH ENERGIZED OH LINES DUE TO CARELESSNESS OF OPERATOR WHO EXTENDED THE JIB (ARM) OF THE CRANE;	THE AFFECTED SECTION OF THE NETWORK HAS BEEN ISOLATED FROM THE 11KV FEEDER. AS AT THE TIME OF INVESTIGATION, SUPPLY HAD NOT YET BEEN RESTORED TO THE AFFECTED NEIGHBORHOOD.	1. MR. HAKEEEM (ROADSIDE VULCANIZER); 2. MR. PANBELE ALLELUIA (ROADSIDE MECHANIC)	NIL	1.ADEQUATE HSE TRAINING/SENSITIZATION SHOULD BE GIVEN TO THE WORKMEN AND DRIVERS WORKING WITHIN THE AREA; 2. THE AFFECTED SECTION OF THE NETWORK SHOULD BE COVERED FROM OVERHEAD TO UNDERGROUND; 3. REGULAR MAINTENANCE CHECKS SHOULD BE CARRIED OUT ON THE INDOOR CIRCUIT BREAKERS OF THE KIRIKIRI BEACHLINE IN/SS IN VIEW OF THE FAULTY TRIP COIL OF ONE OF THE CIRCUIT BREAKERS.

16

17

PLEASE SEE PICTURES ATTACHED

18

19

20