

AREA FIELD OFFICE:		EKO		MONTH:	
S/N	Date of Investigation	Accident Description	Accident Type	Location	DisCo
1	02/12/2019	<p>The victim, MRS SAOFIYAT (Mama Ayo) 45-years old was sleeping inside a metal kiosk situated under an 11kV HT Overhead network when due to heavy rain/thunderstorm at 2:30Pm on Sunday 20th January 2019, the yellow phase conductor which was in an energized state snapped and fell on the metal kiosk thereby electrocuting the lady. She was taken to a hospital but was pronounced dead on arrival.</p>	Electrocution	5, Sofolahan Street, Itire, Mushin, Lagos.	Eko

--	--	--	--	--

|

MONTHLY RETUR**FEBRUARY**

Reported By	DATE REPORTED/ OCCURRED	FATALITIES	INJURIES
ENIEKAN ESSIEN. HoD, Health, Safety and Environment. Eko Electricity Distribution Plc. Marina, HQ, Lagos	Date Reported: 22/1/2018 Date Occurred: 20/1/2019	One	Death



INS ON ACCIDENT INVESTIGATED

Historical Incident (If Any)	Pictures	Investigated By	Possible Root Causes
Nil		Osagie, F.O Oghenegweke, F.O MUSA, W	<p>The snapped HT-11kv overhead line aluminium conductor may be;</p> <ol style="list-style-type: none"> 1. Aging with several jointed parts. 2. Conductors may be deteriorated. 3. Conductors may be unstranded and reduced in size. 4. The conductors may be substandard.



The deceased Mrs Faosiyat (45 years Old)





The Container shop
owned by the deceased
where she was electrocuted.




The HT Pole from which
the Yellow Phase
aluminum conductor
snapped and fell on the
metal kiosk.





The 150mm sq. ACSR rolled and folded from ground level

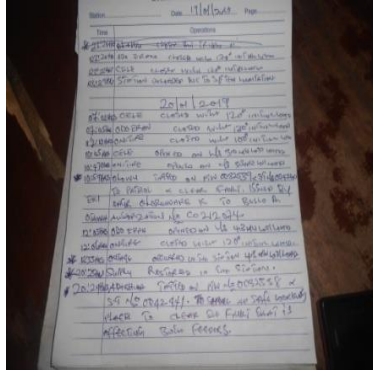

The Log book at the Itire Injection Substation indicating the time of the incident.



A portion of the network with several weak jointed parts.





Very Rough/untidy
network with improperly
executed/weak joints at
sofolahan street, Itire
Road Mushin, Lagos



Actions Taken	Details of eye witnesses (Contacts)	Follow Up Actions (Date) & outcome	Recommendations made to eliminate surface & root causes
<p>The accident was investigated</p>	<p>1. Mrs JOY OKOH (Principal Witness) a business woman who owns a retail shop opposite where the event took place. 2. MALLAM SULEIMAN (A Security man) living in the wooden shack attached to the container shop where the victim got electrocuted.</p>	<p>Nil</p>	<p>1. The entire 11kV HT-Overhead network along Sofolahan street, Itire, mushin, should be replaced with new aluminium 150mm² (ACSR) conductors as it was observed to have deteriorated, unstranded with several weak joints. 2. EKEDC should lay emphasis on proper monitoring /maintenance and rectification and replacement of aging/bad network equipments and accessories.</p>



| |